
INSTALLATION INSTRUCTIONS

INSTALLATION INSTRUCTIONS

PSM 2100 PLASMA DISPLAY STATIC MOUNT

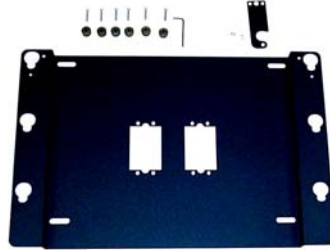


Figure 1

- (1) Plasma Static Mount
- (1) Latching Flag
- (6) Mounting Buttons-Green
- (1) Nylon Washer

- (1) 10-24 x .5 FH Undercut Screw
- (1) 10-24 Nylock Nut
- (6) M5 x 25mm Button Head Cap Screws
- (1) M3 Allen Key

BEFORE PROCEEDING: Unpack the carton, verify contents shown in Figure 1 and read installation instructions completely. If you are missing any of the listed components, please contact Customer Service at 1-800/582-6480.

CAUTION! PLASMA DISPLAYS ARE EXTREMELY FRAGILE.

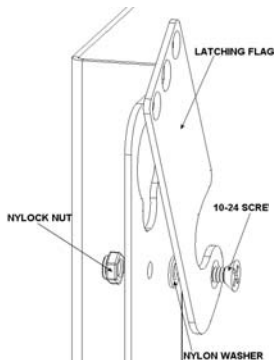


Figure 2

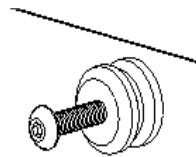


Figure 3

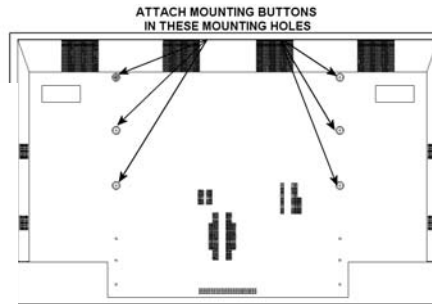


Figure 4

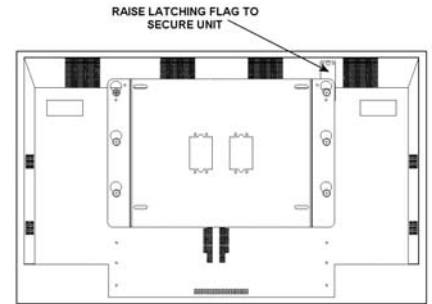


Figure 5

1. Attach latching flag to PSM (see Figure 2). Tighten the nut and screw until friction will hold the flag in place.
2. Attach mounting buttons to plasma using six M5 x 25 cap screws provided (see Figures 3 & 4).

WARNING! **THE SUPPORT STRUCTURE MUST BE CAPABLE OF SUPPORTING 4 TIMES THE COMBINED WEIGHT OF THE PLASMA AND MOUNT.**

3. Securely anchor the plasma static mount to the wall using wall studs or supporting framework.
4. Make sure the flag is lowered to the side before attempting to place the display on the mount.
5. With the aid of another person, lift the display up to the mount, align the mounting buttons on the display with the teardrop slots in the mount, and set the display into place (see Figure 5).
6. Position (raise) the flag to secure the display.



CHIEF MANUFACTURING INC.
1-800-582-6480 952-894-6280 FAX 952-894-6918
8401 EAGLE CREEK PKWY, STE 700
SAVAGE, MINNESOTA 55378 USA

8805-000045 Rev01
2003 Chief Manufacturing
www.chiefmfg.com
09/04