

# INSTALLATION INSTRUCTIONS

## PSB-2630

### PLASMA DISPLAY MOUNTING BRACKET

Prior to assembly, unpack carton completely and verify contents (see Figure 1).

If you are missing any of the following components, please contact Customer Service at 1-800/582-6480.

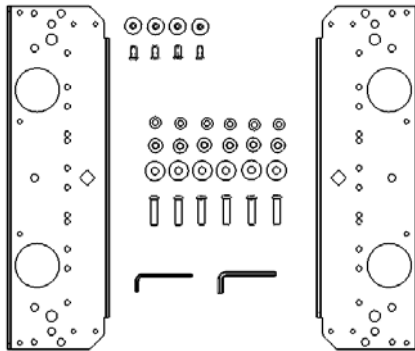


Figure 1

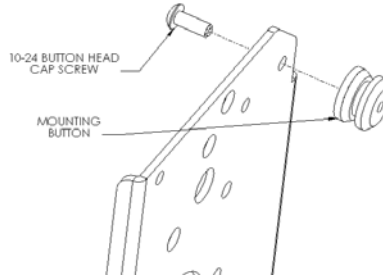


Figure 2

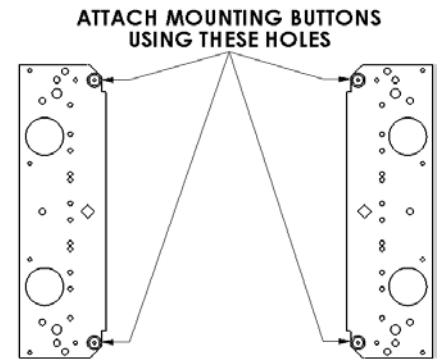


Figure 3

- (2) Plasma Side Bracket
- (4) Mounting Buttons-Tapped 10-24
- (6) M6-1.25 x 30mm Button Head Cap Screw

- (6) .875 x .33 x .375 Nylon Spacer
- (4) 10-24 x 1/2" Button Head Cap Screw
- (6) Shoulder Washer

- (6) Flat Washer
- (1) 4mm Allen Key
- (1) 1/8" Allen Key

**BEFORE PROCEEDING, READ INSTALLATION INSTRUCTIONS COMPLETELY.**

## CAUTION!

**PLASMA DISPLAYS ARE EXTREMELY FRAGILE.**

1. Using a 10-24 button head cap screw inserted from backside of bracket through holes, secure mounting button with chamfered hole of mounting button (larger surface) facing bracket, to bracket (four places) (see Figure 2 and Figure 3).
2. Place Nylon spacers on mounting holes and align hole pattern on brackets with pattern on back of display (see Figure 4 and Figure 5).
3. Attach bracket using the M6 screws using the shoulder washers and flat washers (see Figure 4).
4. With the aid of another person, lift the display up to the Chief Mount, aligning buttons of mounting brackets with slots in the Chief Mount.
5. Lower safety catch on the Chief Mount to secure the display, making sure latch is completely engaged.

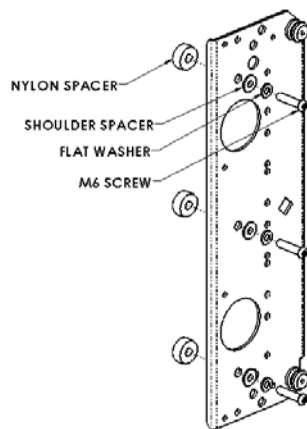


Figure 4

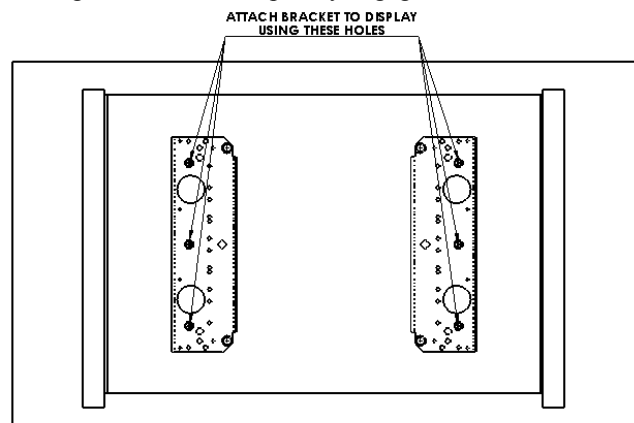


Figure 5