


# INSTALLATION INSTRUCTIONS

## DISPLAY STATIC MOUNT PSM-2533 & 2535

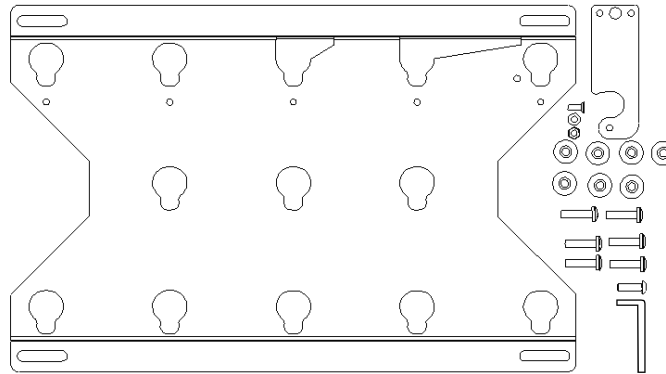

- (1) Display Static Mount  
(1) Latching Flag  
(1) 10-24 Nylock Nut  
(7) Mounting Buttons-Clear Zinc  
(1) M4 Hex Key

Figure 1

- (1) 10-24 x .5 Phillips Flat Head Screw  
(1) Nylon Washer  
(6) M6 x 25mm Phillips Head Cap Screw  
(1) M6 x 20mm Button Head Cap Screw

**BEFORE PROCEEDING:** Unpack the carton, verify contents shown in Figure 1 and read installation instructions completely. If you are missing any of the listed components, please contact Customer Service at 1-800/582-6480.

### **CAUTION!** Displays are Extremely Fragile.

1. Attach latching flag to mount using the 10-24 Phillips flat head screw, Nylon washer, and Nylock nut (see Figure 2). Tighten until friction will hold the flag in place.
2. Using (6) M6 x 25mm Phillips Pan Head Screws, attach (6) mounting buttons to the side mounting holes in the display. Then, using (1) M6 x 20mm Button Head Cap Screw, attach (1) mounting button to the center top mounting hole (see Figure 3 & Figure 4).

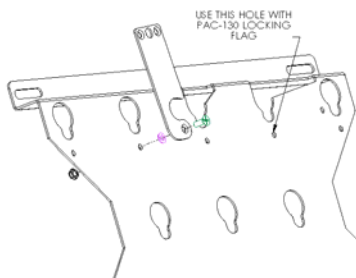


Figure 2

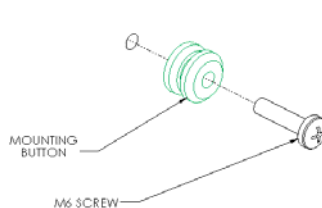


Figure 3

ATTACH MOUNTING BUTTONS TO BACK OF DISPLAY USING THESE HOLES

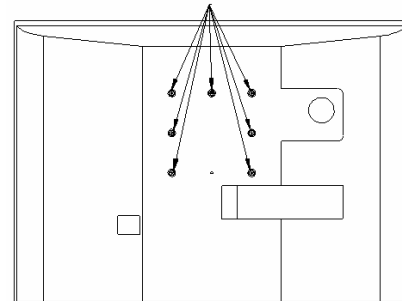


Figure 4

# WARNING

**ALL COMPONENTS MUST BE SECURELY FASTENED TO A STRUCTURAL MEMBER CAPABLE OF SUPPORTING FOUR TIMES THE COMBINED WEIGHT OF ALL COMPONENTS PLUS THE EQUIPMENT BEING MOUNTED. IF IT CANNOT SUPPORT THIS WEIGHT, THE STRUCTURE MUST BE REINFORCED.**

**THE MAXIMUM WEIGHT TO BE INSTALLED ON THE MOUNT IS 175 POUNDS (79.37 KG).**

3. Securely anchor the static mount to wall studs or supporting framework (see WARNING).
4. Make sure the flag is lowered to the side before attempting to place the display on the mount.
5. With the aid of another person, lift the display up to the mount, align the mounting buttons with the teardrop slots in the mount, and set the screen into place (see Figure 5).
6. Position (raise) the flag to secure the display.

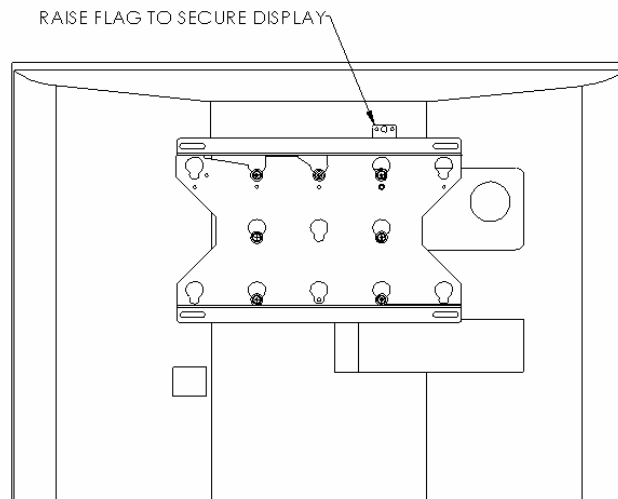


Figure 5